



T-type-i 110/45°

45° angled application for wood doors

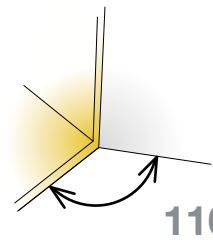

110°

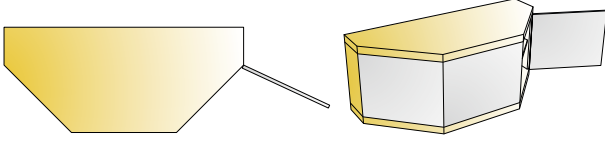






- Opening angle
- Drilling diameter for hinge cup
- Drilling depth
- Hinge on plate mounting system

110°

35mm

12mm

3Way snap-on

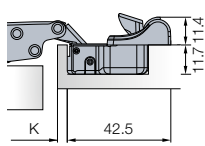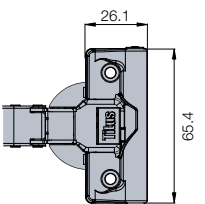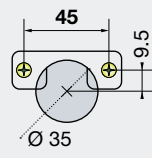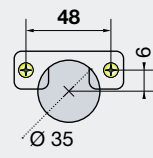		Technical details		
Cranking 17mm 	  	Cup type	Interaxis 45mm  Item number	Interaxis 48mm  Item number
			701-0B08-650	701-0B10-650
			701-0C78-650	701-0C80-650
		EasyFix 	701-0C54-650	701-0C56-650
Drilling patterns for hinge cups → see page 2.17				
 100 Pcs Cup made of steel, arm made of zinc				

Mounting plates



Cam adjustable cruciform mounting plate
→ see page 2.81



Cruciform mounting plate
→ see page 2.83




Cam adjustable linear mounting plate
→ see page 2.81



Face frame adapter plate
→ see page 2.83

Hinge cup screws
If not pre-mounted



820-6328-050

 10000 Pcs

Accessories



Cover caps for hinge arm
→ see page 2.177



Hinge angle restrictor
→ see page 2.175

Legend of hinge cup symbols





Screw-on ready
← screws




Machine insertion ready




EasyFix system



Damping adjustment

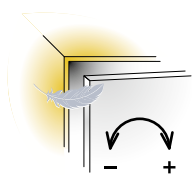


Door adjustment

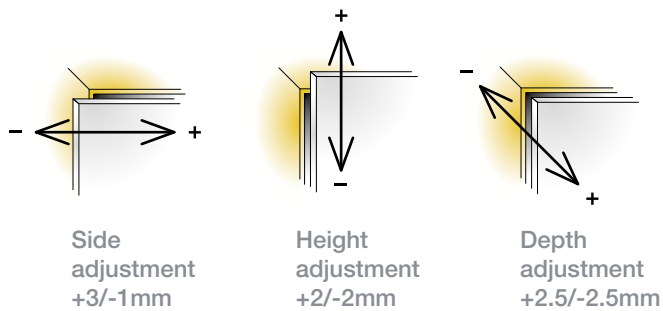


For further explanation → see page 2.25

For further explanation → see pages 2.22-2.24

Mounting details

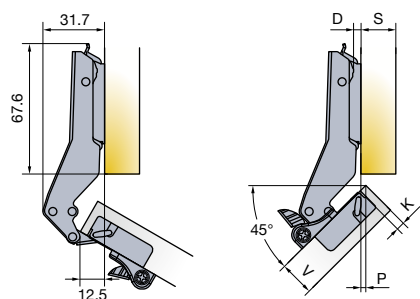

Mounting plate drilling distance


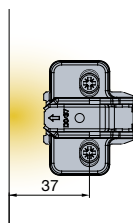


Mounting plate thickness table

For further explanation → see page 2.13

P	0	0.5	1	1.5	2	2.5	3	3.5	4
K	3	2		1		0			
	4	3	2		1		0		
	5		3	2		1		0	
	6	4		3	2		1		0
									D

Drawings show application on D=0mm mounting plate

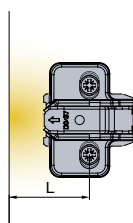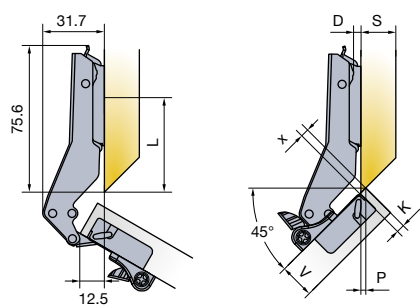

X	0	0.5	1	1.5	2	2.5	3	3.5	4	4.5	5	6
K	3	2		1			0					
	4		2		1			0				
	5		3		2		1			0		
	6	4		3		2		1		0		D

Drawings show application on D=0mm mounting plate

L=45 for thickness D=0
L=44 for thickness D=1
L=43 for thickness D=2
L=42 for thickness D=3
L=41 for thickness D=4


Touch opening



PushOpen Solutions
→ see pages 2.199-2.204

Door clearance at R=1mm

For further explanation → see page 2.14



V	16	17	18	19	20	21	22	23	24	25	26	
K	3	0.5	0.7	0.8	1	1.2	1.5	1.7	2.1	2.8	4.1	5.5
	4	0.4	0.7	0.8	1	1.2	1.5	1.7	2.1	2.3	3.1	4.5
	5	0.4	0.6	0.7	0.9	1.1	1.4	1.6	2	2.2	2.6	3.5
	6	0.4	0.6	0.7	0.9	1.1	1.4	1.6	2	2.2	2.6	2.9
												F _{MIN}

Gap Z_{MIN}=0